

Алматы (7273)495-231
Ангарск (3955)60-70-56
Архангельск (8182)63-90-72
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Благовещенск (4162)22-76-07
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Владикавказ (8672)28-90-48
Владимир (4922)49-43-18
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89

Иваново (4932)77-34-06
Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Коломна (4966)23-41-49
Кострома (4942)77-07-48
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Курган (3522)50-90-47
Липецк (4742)52-20-81

Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Новокузнецк (3843)20-46-81
Ноябрьск (3496)41-32-12
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Петрозаводск (8142)55-98-37
Псков (8112)59-10-37
Пермь (342)205-81-47

Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Саранск (8342)22-96-24
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Сургут (3462)77-98-35
Сыктывкар (8212)25-95-17
Тамбов (4752)50-40-97
Тверь (4822)63-31-35

Тольятти (8482)63-91-07
Томск (3822)98-41-53
Тула (4872)33-79-87
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Улан-Удэ (3012)59-97-51
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Чебоксары (8352)28-53-07
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Чита (3022)38-34-83
Якутск (4112)23-90-97
Ярославль (4852)69-52-93

Россия +7(495)268-04-70

Казахстан +7(7172)727-132

Киргизия +996(312)96-26-47

<https://microsensor.nt-rt.ru/> || moj@nt-rt.ru

Датчик давления МРМ3801. Технические характеристики.



5bar/7bar/10bar/16bar/20bar/35bar/70bar/100bar/
200bar/350bar/700bar/1000bar

Features

- Gauge, absolute, sealed gauge
- Isolated construction, enable to measure various liquid
- Standard sensor dimension, wide range of applications

Application

- Industrial process control
- Gas, liquid pressure measurement
- Pressure checking meter
- Liquid pressure system and switch
- Cooling equipment and air conditioning system
- Aviation and navigation inspection


- Pressure Type: Gauge/ Absolute/Sealed Gauge
- Overpressure: 1.5FS or 1100bar (min. value is valid)
- Accuracy: $\pm 0.25\%FS$ (typ.); $\pm 0.5\%FS$ (max.)
- Output Digital Value: 1638 (zero)~14746 (span)
- Output Digits: 14 digits (max. 16383)
- Power Supply: $3.3 \pm 0.1V$ DC(default); $5 \pm 0.1V$ DC
- Power Consumption: 5uA (standby mode) @25 °C
- Long Term Stability: $\pm 0.2\%FS$ /year
- Working Temperature: -20 °C~80 °C
- Storage Temperature: -40 °C~125 °C
- Compensation temperature:-10 °C~50 °C
- Shock: 10g, 20Hz~2000Hz
- Impact:100g, 11ms

Note


Accuracy is $\pm 1\%$ when pressure is $\leq 0.35bar$, Accuracy is $\pm 0.5\%$ when pressure is $\geq 70bar$.

Sensor pressure output is 14-digit, the max. output digital value is 16383, but in order to leave a certain overpressure value, the upper and lower limits of the digital quantity are left 10% each, the zero and full values are 1638 and 14746.

Outline Construction (Unit: mm)

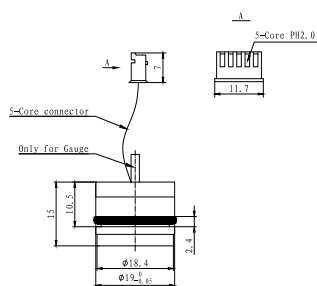

Electrical Connection

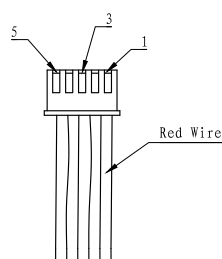

Wire number (red: 1)	Electrical connection (I ² C)	Electrical connection (SPI)
1	V-	V-
2	V+	V+
3	SCL	SCLK
4	SDA	MISO
5	NULL	SS

Order Guide

MPM3801		Digital Output Pressure Transducer				
	Range	Range: 0bar~0.07bar/0.2bar/0.35bar/0.7bar/1bar/2bar/3.5bar/5bar/7bar/10bar/16bar/20bar/35bar/70bar/100bar/200bar/350bar/700bar/1000bar				
		[0~X]bar				
		X: actual measured range				
		Code Power Supply				
		3 (3.3±0.1)V DC (default)				
		5 (5±0.1)V DC				
		Code Communication interface				
		C I ² C				
		D SPI				
		Code Pressure Type				
		G Gauge (Range≤35bar)				
		A Absolute (Range≥0.7bar)				
		S Sealed Gauge (Range≥35bar)				
MPM3801	[0~X]bar	3	C	G	the whole spec.	

Notes

1. Please pay attention that the measured media shall be compatible with contacted parts.
2. The sensor has temperature output which is a reference value. The reference precision is $\pm 1.5^{\circ}\text{C}$ (@ constant temperature condition), If the sensor range $\geq 70\text{bar}$, no temperature output.
3. For special requirements, please contact us and make note in purchase order.

Алматы (7273)495-231
Ангарск (3955)60-70-56
Архангельск (8182)63-90-72
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Благовещенск (4162)22-76-07
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Владикавказ (8672)28-90-48
Владимир (4922)49-43-18
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89

Иваново (4932)77-34-06
Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Коломна (4966)23-41-49
Кострома (4942)77-07-48
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Курган (3522)50-90-47
Липецк (4742)52-20-81

Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Новокузнецк (3843)20-46-81
Ноябрьск (3496)41-32-12
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Петрозаводск (8142)55-98-37
Пермь (8112)59-10-37
Пермь (342)205-81-47

Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Саранск (8342)22-96-24
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Сургут (3462)77-98-35
Сыктывкар (8212)25-95-17
Тамбов (4752)50-40-97
Тверь (4822)63-31-35

Тольятти (8482)63-91-07
Томск (3822)98-41-53
Тула (4872)33-79-87
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Улан-Удэ (3012)59-97-51
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Чебоксары (8352)28-53-07
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Чита (3022)38-34-83
Якутск (4112)23-90-97
Ярославль (4852)69-52-93

Россия +7(495)268-04-70

Казахстан +7(7172)727-132

Киргизия +996(312)96-26-47

<https://microsensor.nt-rt.ru/> || moj@nt-rt.ru